

ALERT SERVICE BULLETIN
REVISION NOTICE
Bell Helicopter **TEXTRON**
A Subsidiary of Textron Inc.

DATE Sept 20, 2007

TO: All Owners/Operators of Bell 222 and 222B Helicopters

**SUBJECT: REVISION "C" TO ALERT SERVICE BULLETIN 222-07-106:
TAIL ROTOR BLADE ASSEMBLY, INSPECTION OF**

Revision "C" to this bulletin re-organises the affected blade list to include the blade part numbers. No additional blade serial numbers were added to the affected blade list. The affected blade part numbers listed in this ASB reflect the last dash number of the blades as they left Rotor Blade, Inc. (RBI). Upgrade/modification of the blades in the field since then may have altered the blade last dash number. Verify part number on blade and in the blade component history card records. The model 222/222B/222U/230/430 tail rotor blades are all built in consecutive serial numbers regardless of the blade last dash number.

AN APPROPRIATE ENTRY SHOULD BE MADE IN THE AIRCRAFT LOGBOOK UPON ACCOMPLISHMENT
IF OWNERSHIP OF AIRCRAFT HAS CHANGED PLEASE FORWARD TO NEW OWNER

ALERT SERVICE BULLETIN
Bell Helicopter **TEXTRON**

A Subsidiary of Textron Inc.

NO. 222-07-106

DATE SEP 11, 2007

PAGE 1

DATE SEP 20, 2007

REV C

MODEL AFFECTED: 222 and 222B

SUBJECT: TAIL ROTOR BLADE ASSEMBLY, INSPECTION OF

HELICOPTERS AFFECTED: All Model 222 and 222B helicopters

COMPLIANCE: Prior to first flight.

DESCRIPTION:

The purpose of this bulletin is to achieve complete distribution of the attached RBI letter to Bell Helicopter's current operator list.

Affected tail rotor blades that have been inspected/repared in accordance with this ASB shall have letter "L" vibro-etched immediately following the part number on the tail rotor blade ID tag and returned to service.

APPROVAL:

Not required.



September 11, 2007
Mr. Jack Denham
Executive Director of Product Support
Bell Helicopter Textron

Rotor Blades, Inc. (RBI) has received reports of three incidents in which weights were slung from tail rotor blades during flight significant causing vibration. The failures reported occurred ranging from 400 flight hours since repair to as short as 12 minutes. We have determined that this may affect most Bell models. To ensure safety and to expedite re-inspection required, we advise and ask you distribute to fleet on a most urgent basis.

Investigation indicates that tip weight screws may be missing the adhesive applied during the weight and balance process on these blades. The blades in question were all processed by one former RBI technician.

RBI has initiated customer contact and inspection of blades to reduce customer impact. Additionally, we are working with our local FAA representative to ensure regulations are met. I ask Bell support and assistance to ensure DOT and OEM requirements are met for release.

RBI is capable of carrying out inspection to existing requirements. Balance weight screws must be accessed and verified for correct installation. This must be carried out by a Bell approved Rotor Blade Repair Facility.

BEFORE THE NEXT FLIGHT, ALL OPERATORS SHOULD INSPECT THEIR TAIL ROTOR BLADES USING THE ATTACHED LIST TO DETERMINE WHETHER THEIR BLADES ARE AFFECTED. ALL AFFECTED BLADES SHOULD BE REMOVED FROM SERVICE IMMEDIATELY AND RETURNED TO AN RBI FACILITY FOR EXAMINATION AND REPAIR.

The list attached includes all blades RBI has determined re-inspection is required on.

Troy Penny
Director of Operations
Rotor Blades Inc.

Warranty Statement:

Owners / Operators of Bell Helicopters who comply with the instructions in this Bulletin will be eligible to return defective blades identified by serial number in the compliance section of this bulletin to your nearest RBI facility for inspection and repair at no cost. In order to process your request please contact your local RBI facility to make arrangements for the return of the blade or blade's using RBI's FedEx account #2546-92336.

Rotor Blades Inc.
580 St Etienne Road
Broussard, LA 70518
Phone 337-839-2119
Fax 337-839-2122

RBI Hawker Limited
LIU FZS1 BD06/07, JAFZ (South)
P.O. Box 16784
Dubai, UAE
Phone 971-4-886-0144
Fax 971-4-886-0145

Rotor Blades Limited
5B Crusader Park
Bath Road
Warmintser
Wiltshire BA12 8SJ
United Kingdom
Phone 44-1985-847040
Fax 44-1985-846356

Part Number	S/N
222-016-001-123	A- 960
	A- 970
	A- 1337
	A- 1340
	A- 1371
	A- 1373
	A- 1375
	A- 1382
	A- 1390
	A- 1398
	A- 1400
	A- 1402
	A- 1411
	A- 1419
	A- 1452
	A- 1466

Part Number	S/N
222-016-001-131	A- 1621
	A- 1652
	A- 1660
	A- 1766
	A- 1785
	A- 1806
	A- 1816
	A- 1820
	A- 1842
	A- 1849
	A- 1856
	A- 1860
	A- 1883
	A- 1884
	A- 1892
	A- 1893
	A- 1899
	A- 1912
	A- 1914
	A- 1919
	A- 1921
	A- 1985
	A- 1995
	A- 1996
	A- 2011
	A- 2020
	A- 2042
	A- 2052
	A- 2053
	A- 2059
	A- 2062
	A- 2064
	A- 2065
A- 2178	
A- 2200	

Part Number	S/N
222-016-001-139M	A- 1523
	A- 1528
	A- 1538
	A- 1569
	A- 1585
	A- 1655
	A- 1760
	A- 1769
	A- 1781
	A- 1788
	A- 1801
	A- 1826
	A- 1838
	A- 1850
	A- 1853
	A- 1869
	A- 1874
	A- 1875
	A- 1876
	A- 1881
	A- 1885
	A- 1891
	A- 1894
	A- 1900
	A- 1903
	A- 1908
	A- 1909
	A- 1910
	A- 1918
	A- 1922
	A- 1927
	A- 1930
	A- 1931
	A- 1936
	A- 1938
	A- 1943
	A- 1963
	A- 1974
	A- 1984
	A- 1988
	A- 1989
	A- 1990
	A- 2024
	A- 2027
	A- 2029
	A- 2030
	A- 2031
A- 2034	
A- 2047	
A- 2057	
A- 2058	
A- 2066	
A- 2067	
A- 2083	
A- 2169	
A- 2170	
A- 2179	
A- 2185	

Part Number	S/N
222-016-001-123M	A- 1123
	A- 1126
	A- 1127
	A- 1130
	A- 1479
	A- 1488

Part Number	S/N
222-016-001-127	A- 1169
	A- 1175
	A- 1195
	A- 1225
	A- 1236
	A- 1284

Part Number	S/N
222-016-001-135	A- 1633

Part Number	S/N
222-016-001-141M	A- 1582
	A- 1583
	A- 1634
	A- 1637

C