## ALERT SERVICE BULLETIN REVISION NOTICE

### **Bell Helicopter TEXTRON**

A Subsidiary of Textron Inc.

DATE Nov 29, 2010

TO: All Owners/Operators of Bell 222 and 222B Helicopters

SUBJECT: REVISION "D" TO ALERT SERVICE BULLETIN 222-07-106: TAIL ROTOR BLADE ASSEMBLY, INSPECTION OF

Revision "D" to this bulletin adds tail rotor blade serial numbers to the list affected by this ASB.

Tail rotor blades listed and inspected in accordance with previous revisions of this bulletin are not affected by this Revision "D".

# ALERT SERVICE BULLETIN Bell Helicopter TEXTRON

A Subsidiary of Textron Inc.

NO. 222-07-106

**DATE** SEP 11, 2007

PAGE

1

SUBJECT: TAIL ROTOR BLADE ASSEMBLY, INSPECTION

222 and 222B

OF

HELICOPTERS AFFECTED: All Model 222 and 222B helicopters

**COMPLIANCE:** Prior to first flight.

#### **DESCRIPTION:**

**DATE** Nov 29, 2010

**REV** 

D

**MODEL AFFECTED:** 

The purpose of this bulletin is to achieve complete distribution of the attached RBI letter to Bell Helicopter's current operator list.

Affected tail rotor blades that have been inspected/repaired in accordance with this ASB shall have letter "L" vibro-etched immediately following the part number on the tail rotor blade ID tag and returned to service.

#### **APPROVAL:**

Not required.



#### **REVISION A November 10, 2010**

#### **Bell Product Support Engineering,**

Rotor Blades Inc. has received a fourth blade in which one tip weight was lost in flight. This blade was balanced during the term of employment of the former RBI technician noted below. This occurrence has prompted RBI to recall all tail rotors balanced during former technician's term of employment.

The list attached includes additional blades RBI now considers suspect. We are asking Bell Product Support to re-issue affected ASB's calling for immediate inspection of affected blades.

September 11, 2007

Mr. Jack Denham

Executive Director of Product Support Bell Helicopter Textron

Rotor Blades, Inc. (RBI) has received reports of three incidents in which weights were slung from tail rotor blades during flight and causing vibration. The failures reported occurred ranging from 400 flight hours since repair to as short as 12 minutes. We have determined that this may affect most bell models. To ensure safety and to expedite re-inspection required we advise and ask you distribute to fleet on a most urgent basis.

Investigation indicates that tip weight screws may be missing the adhesive applied during the weight and balance process on these blades. The blades in question were all processed by one former RBI technician.

RBI has initiated customer contact and inspection of blades to reduce customer impact. Additionally, we are working with our local FAA representative to ensure regulations are met. I ask Bell support and assistance to ensure DOT and OEM requirements are met for release.

RBI is capable of carrying out inspection to existing requirements. Balance weight screws must be accessed and verified for correct installation. This must be carried out by a Bell approved Rotor Blade Repair Facility.

BEFORE THE NEXT FLIGHT, ALL OPERATORS SHOULD INSPECT THEIR BLADES USING THE ATTACHED LIST TO DETERMINE WHETHER THEIR BLADES ARE AFFECTED. ALL AFFECTED BLADES SHOULD BE REMOVED FROM SERVICE IMMEDIATELY AND RETURNED TO AN RBI FACILITY FOR EXAMINATION AND REPAIR.

The list attached includes all blades RBI has determined re-inspection is required on.

Troy Penny
Director of Operations
Rotor Blades Inc.

#### Warranty Statement:

Owners / Operators of Bell Helicopters who comply with the instructions in this Bulletin will be eligible to return defective blades identified by serial number in the compliance section of this bulletin to your nearest RBI facility for inspection and repair at no cost. In order to process your request please contact your local RBI facility to make arrangements for the return of the blade or blade's using RBI's FedEx account #2546-92336.

Rotor Blades Inc. 580 St Etienne Road Broussard, LA 70518 Phone 337-839-2119 Fax 337-839-2122

RBI Hawker Limited LIU FZS1 BD06/07, JAFZ (South) P.O. Box 16784 Dubai, UAE Phone 971-4-886-0144 Fax 971-4-886-0145

Rotor Blades Limited 5B Crusader Park Bath Road Warmintser Wiltshire BA12 8SJ United Kingdom Phone 44-1985-847040 Fax44-1985-846356

Part Number	S/N	Part Number	S/N
222-016-001-123	A-960	222-016-001-131	A-2064
0.0 000	A-970	0.0 000.	A-2065
	A-1337		A-2178
	A-1340 A-1371		A-2200
	A-1373	222-016-001-135	A-1633
	A-1375	222 046 004 420M	A 4500
	A-1382 A-1390	222-016-001-139M	A-1523 A-1528
	A-1398		A-1538
	A-1400		A-1569
	A-1402 A-1411		A-1585 A-1655
	A-1419		A-1760
	A-1452		A-1769
	A-1466		A-1781 A-1788
222-016-001-123M	A-1123		A-1801
	A-1126		A-1826
	A-1127 A-1130		A-1838 A-1850
	A-1479		A-1853
	A-1488		A-1869
222-016-001-127	A-1169		A-1874 A-1875
222-010-001-127	A-1109 A-1175		A-1876
	A-1195		A-1881
	A-1225		A-1885
	A-1236 A-1284		A-1891 A-1894
			A-1900
222-016-001-131	A-1621		A-1903
	A-1652 A-1660		A-1908 A-1909
	A-1766		A-1910
	A-1785		A-1918
	A-1806 A-1816		A-1922 A-1927
	A-1820		A-1930
	A-1842		A-1931
	A-1849 A-1856		A-1936 A-1938
	A-1860		A-1943
	A-1883		A-1963
	A-1884 A-1892		A-1974 A-1984
	A-1893		A-1988
	A-1899		A-1989
	A-1912 A-1914		A-1990 A-2024
	A-1914 A-1919		A-2024 A-2027
	A-1921		A-2029
	A-1985		A-2030
	A-1995 A-1996		A-2031 A-2034
	A-2011		A-2047
	A-2020		A-2057
	A-2042 A-2052		A-2058 A-2066
	A-2053		A-2067
	A-2059		A-2083
	A-2062		A-2169

Part Number 222-016-001-139M 222-016-001-141M	S/N A-2170 A-2179 A-2185 A-1582 A-1583 A-1634 A-1637				
222-016-001-123	A-1352 A-1384 A-1409 A-1477		222-016-001-139 222-016-001-139M	A-2102 A-1648 A-1794 A-1796	
222-016-001-123M	A-1341 A-1365 A-1440			A-1902 A-1904 A-1960 A-1965	D
222-016-001-127	A-1199 A-1221 A-1224 A-1226 A-1282	D		A-1967 A-1994 A-1997 A-2002 A-2019 A-2022	D
222-016-001-131	A-1649 A-1650 A-1671 A-1676 A-1760 A-1872 A-1877 A-1878 A-1887 A-1959 A-2101 A-2163 A-2237			A-2162 A-2188 A-2192	
222-016-001-135	A-1520 A-1554				