

**OPERATIONS SAFETY NOTICE**

February 12, 2001

**OSN 212-01-38  
OSN 412-01-24  
OSN 412CF-01-04**


**TO: All Owners/Operators of Bell 212/412/412CF Helicopters**  
**SUBJECT: ENGINE INTAKE FAIRING P/N 212-061-207-023 / -025, Inspection Of**

Bell Helicopter Textron has received reports of the P/N 212-061-207-023 / -025 fairing assembly not being installed properly.

The P/N 212-061-207-023 / -025 fairing should be inspected to ensure the ramp (yellow portion) is positioned underneath the joggle at the forward end.

Replace detail parts as required if any cracks or deformations are observed on the ramp portion.

See attached figures.

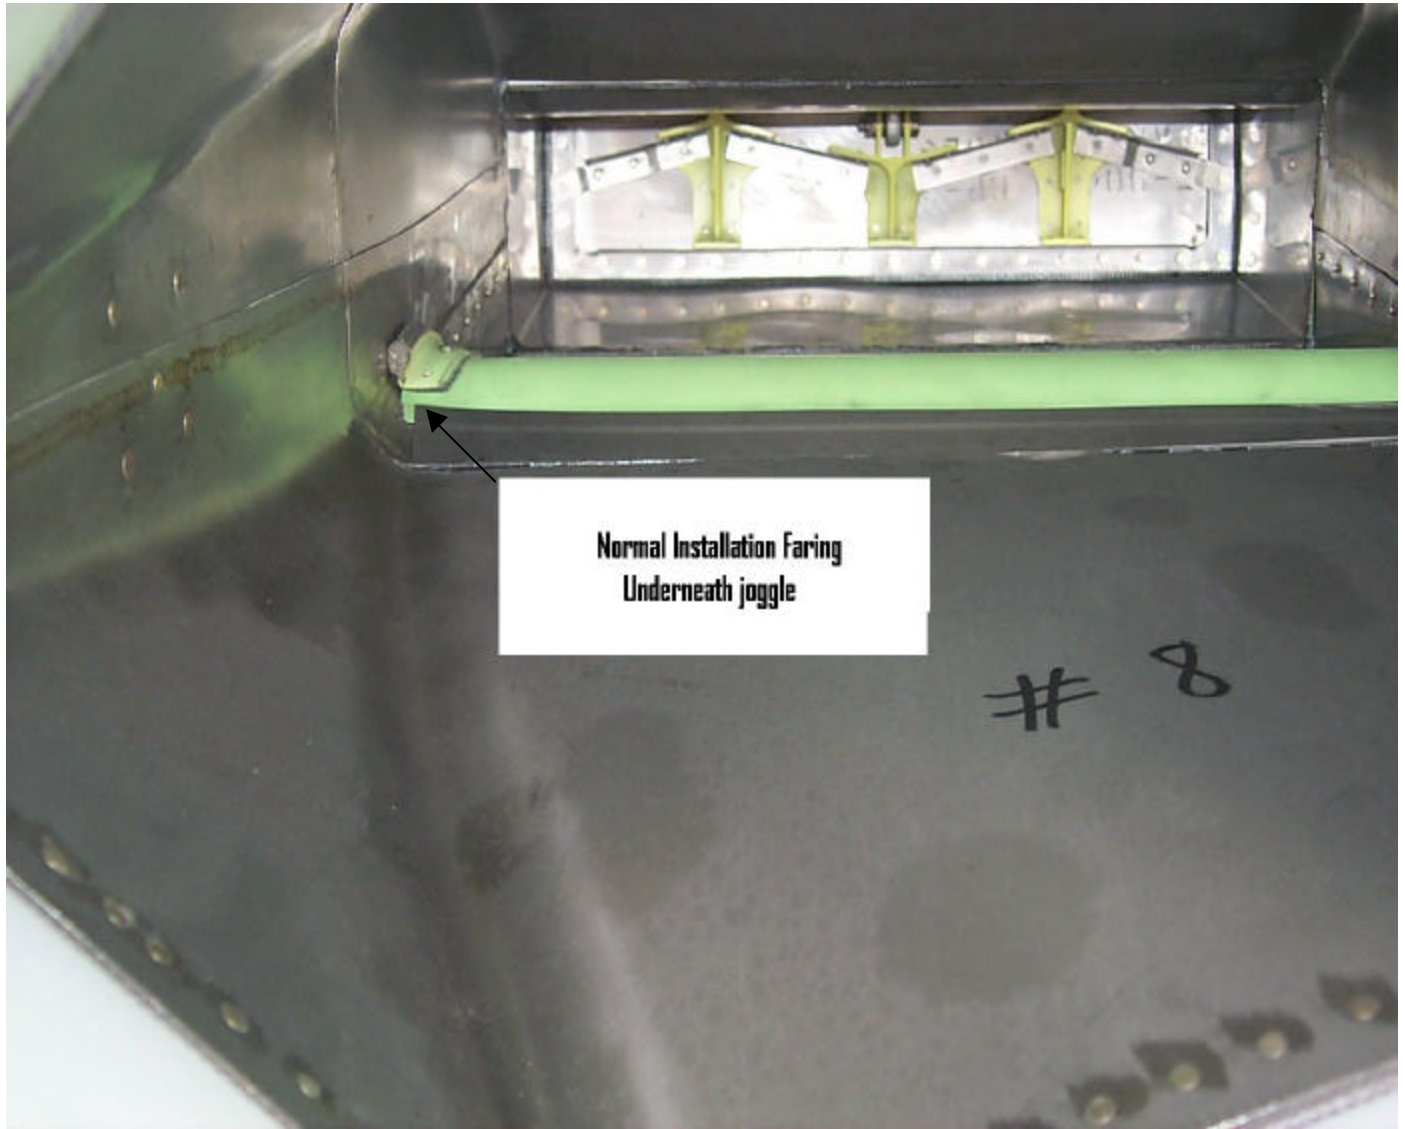

Normal installation fairing underneath joggle

**Figure 1**



Abnormal installation fairing on top of joggle

**Figure 2**